



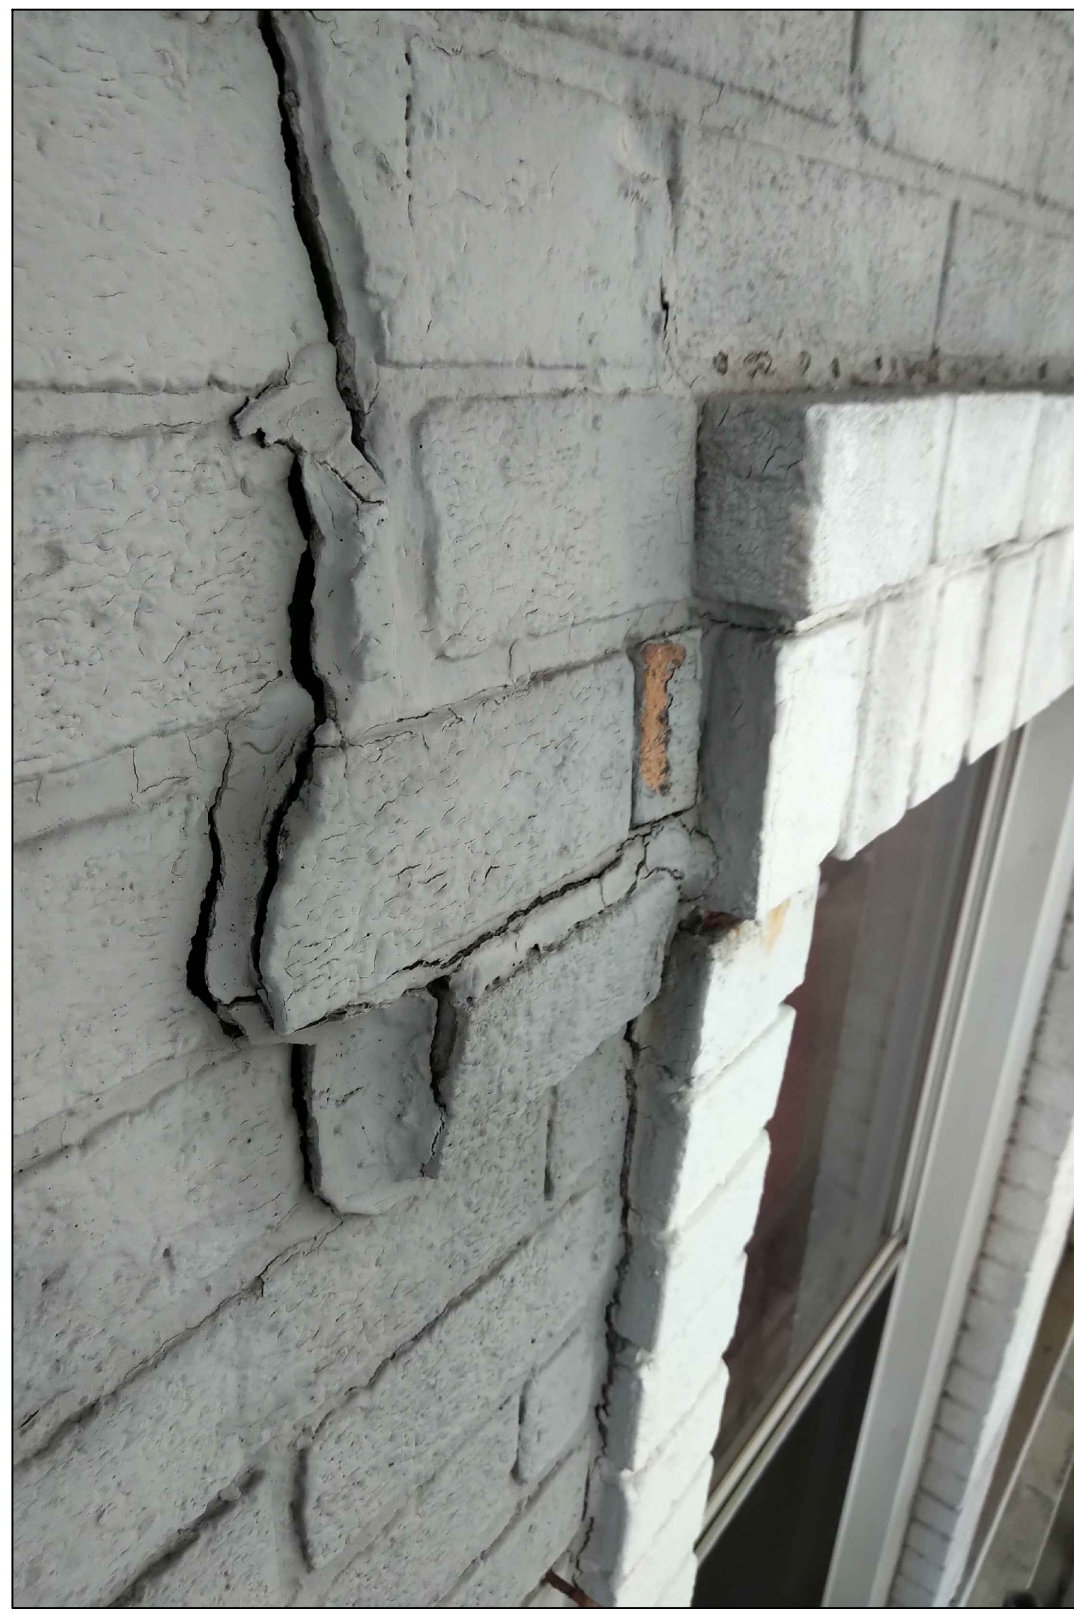


SECOND FLOOR WINDOWS: BRICK JAMBS HEAD AND ARCH DETAIL. FACADE MOVEMENT; CRACKED DAMAGED AND PROTRUDING BRICKS
MOVEMENT GAP NOTICEABLE AT WINDOW HEAD.




MISSING MORTAR, EXPANDED JOINTS BECAUSE OF MOVEMENT; GAP AT STEEL LINTEL
NOTE THE RUST STAINS FROM THE LINTEL ON THE WINDOW

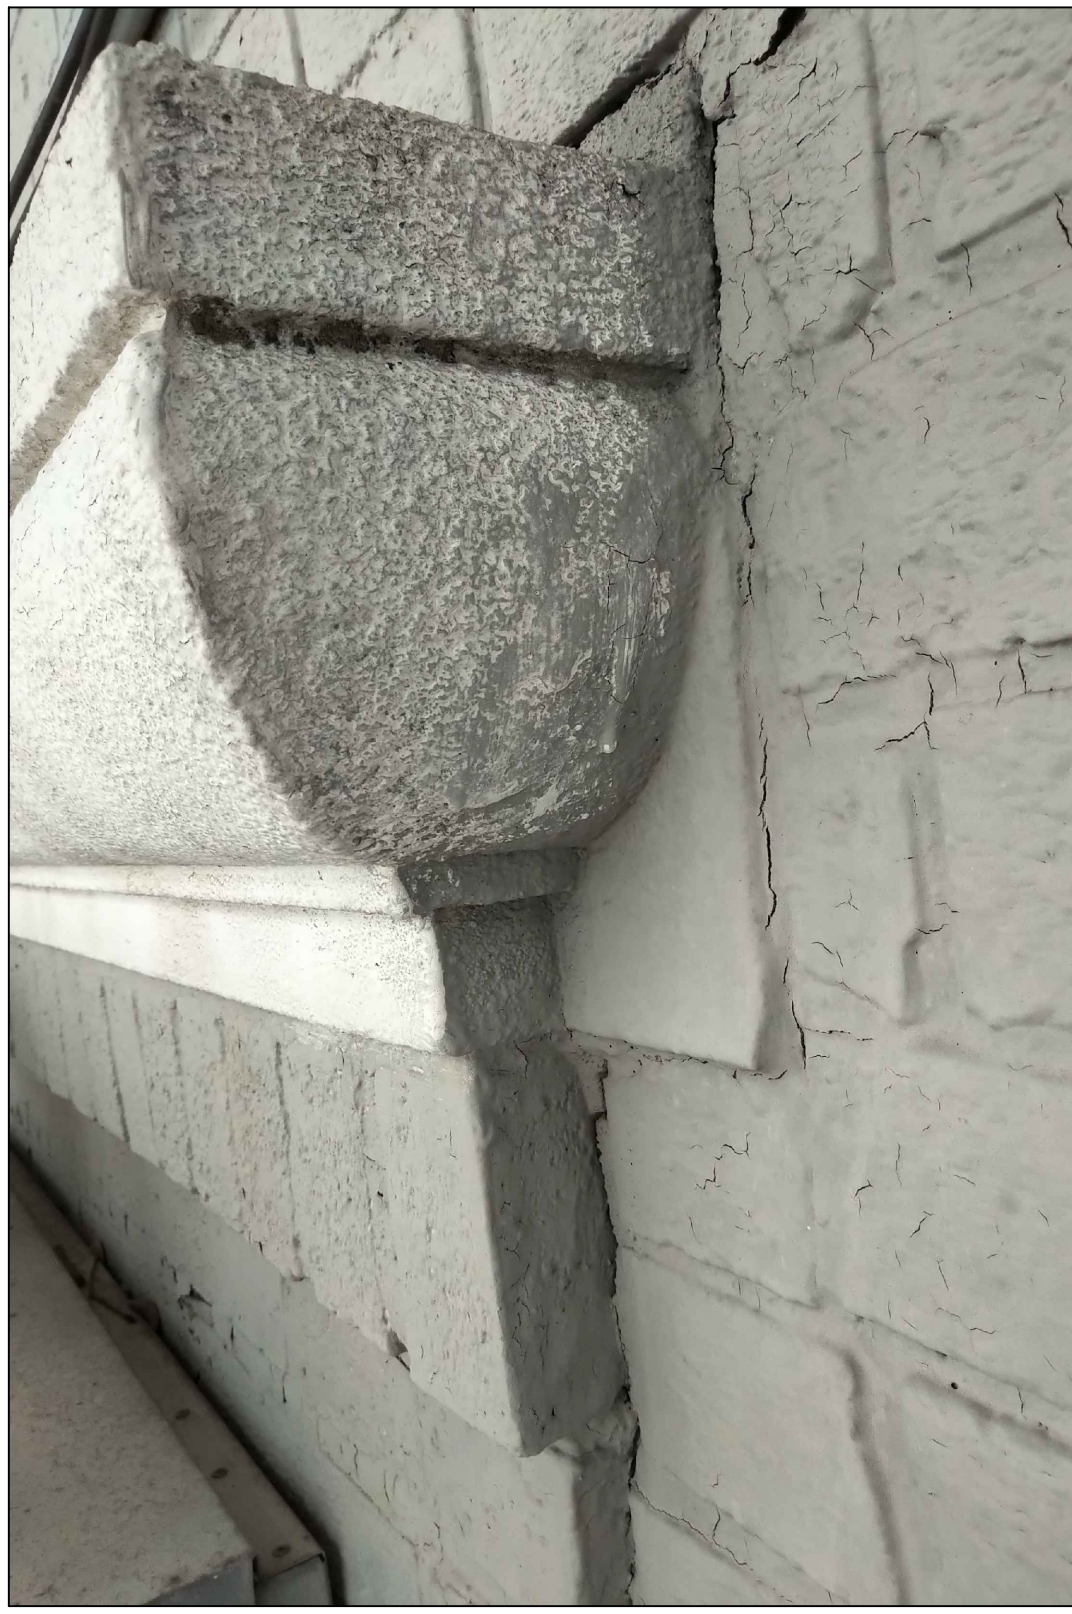

STONE SILL AND BRICK DETAIL

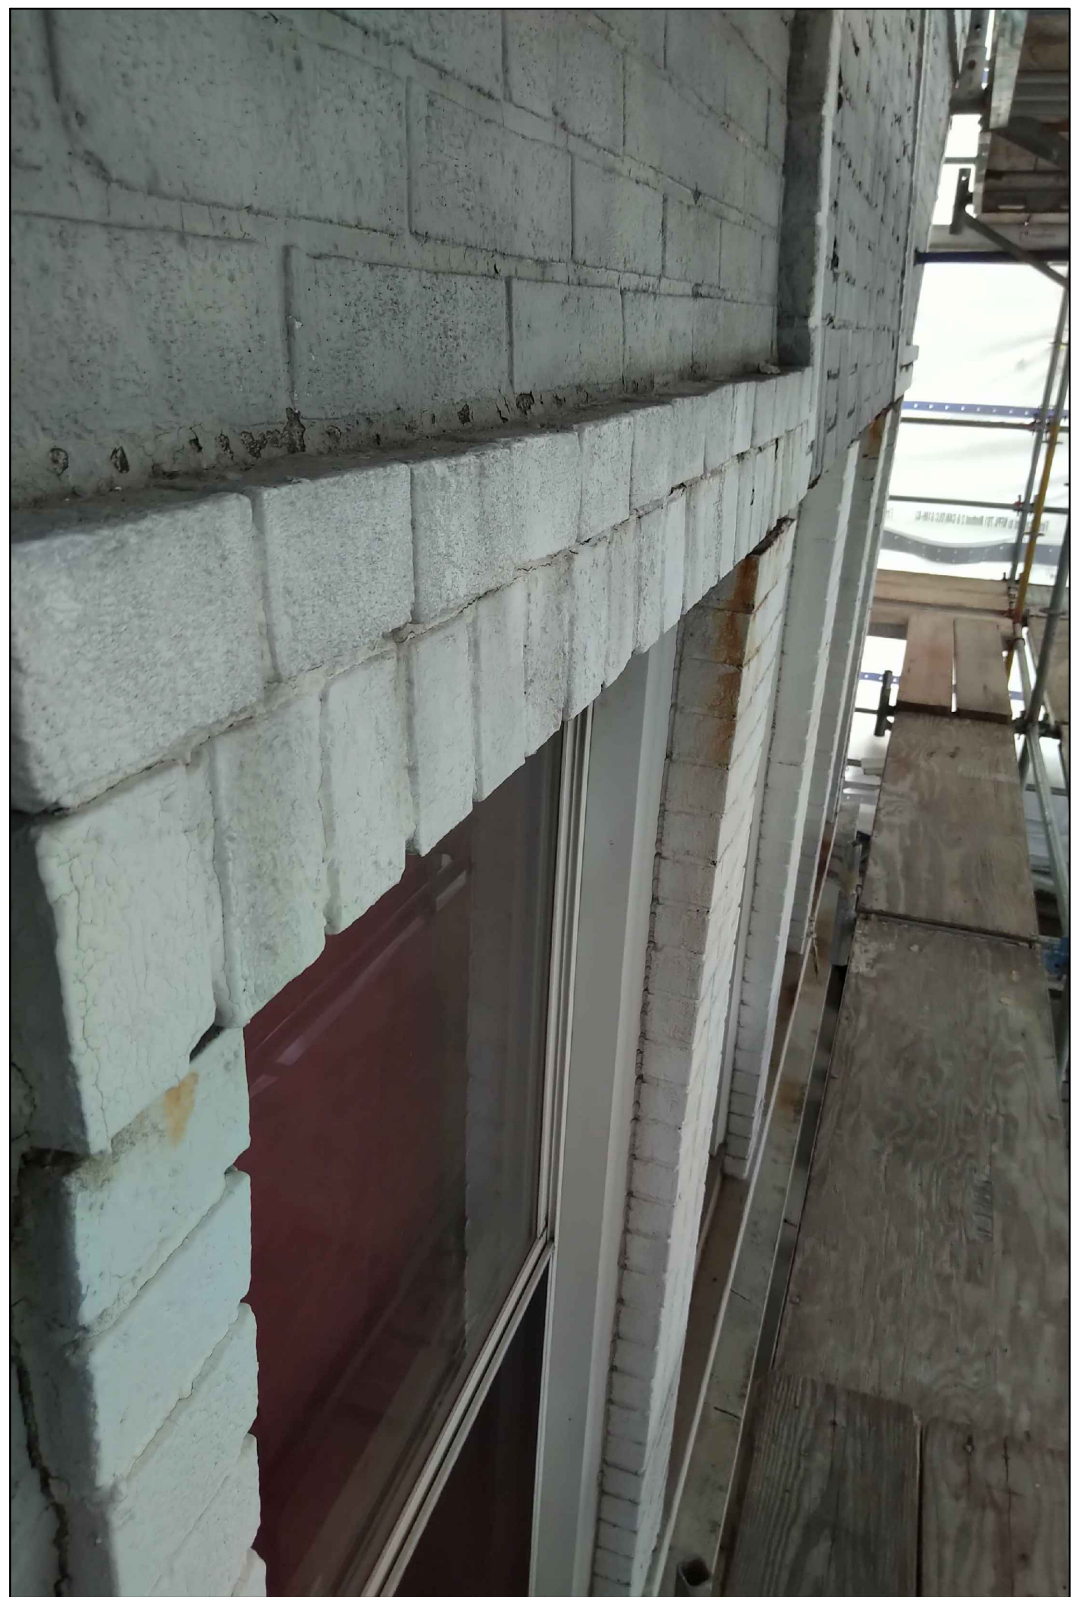

UPPER WINDOW HEADER BRICK DETAIL

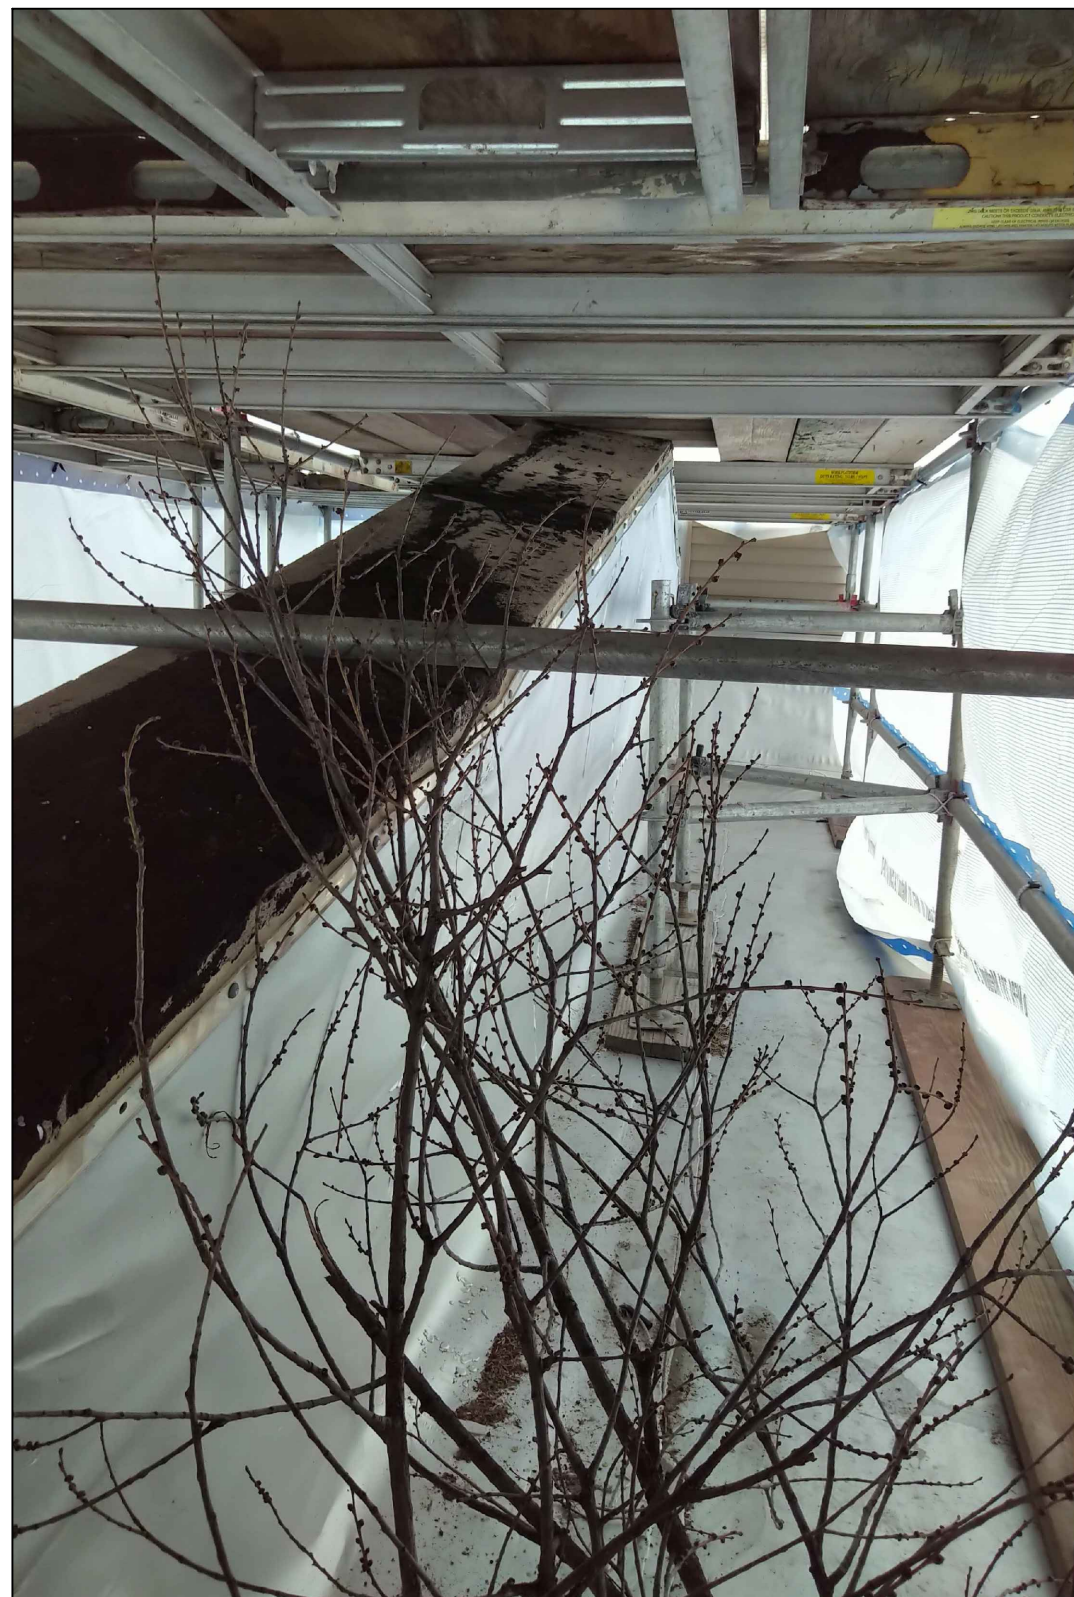

TREE GROWING ON ROOF - ROOF DAMAGE; WATER DAMAGE TO WALL AND POOR DRAINAGE. BAD JOINTS BETWEEN COPING STONES



MOVEMENT CRACK FROM WINDOW LINTEL TO WEST WALL AT COIN DETAIL



UPPER WEST CORNER DETAIL - WATER INFILTRATION DAMAGE
BRICK AND COPING MOVEMENT



COPING STONES IMPROPERLY SEALED WITH ASPHALT



BEST PHOTO TO SHOW THE "LEANING" OF THE UPPER PORTION OF WALL. AT LEAST 5 DEGREES OUT OF PLUMB



UPPER WEST CORNER DETAIL - WATER INFILTRATION DAMAGE
BRICK AND COPING MOVEMENT - POOR JOINT REPAIR

FACADE RESTORATION 1119 WEST HISTORIC MITCHELL STREET MILWAUKEE, WI 53204

SchultzWerk
Architecture, Inc.
2515 North 66th Street
Wauwatosa, WI 53213
414.322.7374
swerk@juno.com

ARCHITECT:
Keith Schultz, ALA, ASID



REVISIONS

PROJECT NO. 22047.00
DATE 8/25/2022
DRAWN BY
CHECKED BY

SHEET CONTENTS
PHOTOS