



## Certificate of Appropriateness—Amended

Milwaukee Historic Preservation Commission/200 E. Wells Street/Milwaukee, WI 53202/phone 414-286-5712/fax 414-286-3004

<b>Property</b>	2682 N. SUMMIT AV.	North Point North HD
<b>Description of work</b>	Structural repairs to garage that will require rebuilding the brick exterior walls. Brick will be reused to the maximum extent possible and replacement brick will be installed low to the ground on elevations that do not face the street. Rebuild footings/foundation to current code requirements	
<b>Date issued</b>	4/16/2018; Amd. 5/22/18	PTS ID 114506 COA: garage repairs

In accordance with the provisions of Section 320-21 (11) and (12) of the Milwaukee Code of Ordinances, the Milwaukee Historic Preservation Commission has issued a certificate of appropriateness for the work listed above. The work was found to be consistent with preservation guidelines. The following conditions apply to this certificate of appropriateness:

New mortar must match the original mortar in terms of color, texture, grain size, joint width, and joint finish/profile. The compressive strength of the repointing mortar shall be equal or less than the compressive strength of the original mortar and surrounding brick or stone. The replacement mortar shall contain approximately the same ingredient proportions of the original mortar. Mortar that is too hard is subject to premature failure and could damage the masonry. See the city's books *As Good As New*, Masonry Chapter, for more information. In most cases, this means a lime mortar with natural hydraulic cement rather than Portland cement. No joint of a width less than 3/8" may be cleaned of damaged/decomposed mortar with power disc grinders. No over-cutting of the joints is permitted. Remove decomposed mortar back into the wall 2.5 times the height of the joint before tuckpointing. New brick must match as closely as possible the color texture, size, and finish of the original brick. A sample panel of brick and mortar must be reviewed and approved by HPC staff prior to general installation of the material.

All work must be done in a craftsman-like manner, and must be completed within one year of the date this certificate was issued. Staff must approve any changes or additions to this certificate before work begins. Work that is not completed in accordance with this certificate may be subject to correction orders or citations. If you require technical assistance, please contact Historic Preservation staff as follows: Phone: (414) 286-5712 E-mail: HPC@milwaukee.gov.

If permits are required, you are responsible for obtaining them from the Milwaukee Development Center. If you have questions about permit requirements, please consult the Development Center's web site, [www.milwaukee.gov/build](http://www.milwaukee.gov/build), or call (414) 286-8210.




---

City of Milwaukee Historic Preservation Staff


Copies to: Development Center, Ald. Nik Kovac, Contractor, Inspector Paul Wolfgramm (286-2590)

Existing conditions, current brick and mortar detail (color) on garage at right.



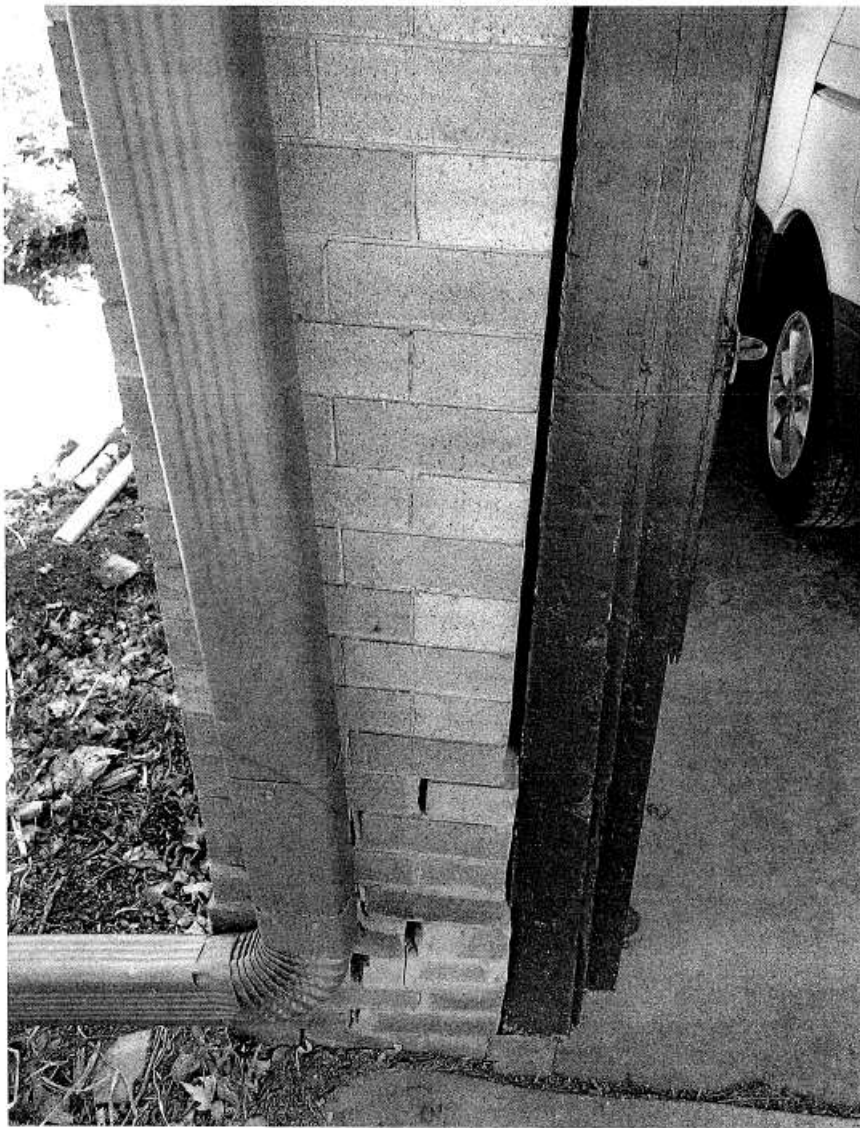

NW corner - WEST WALL

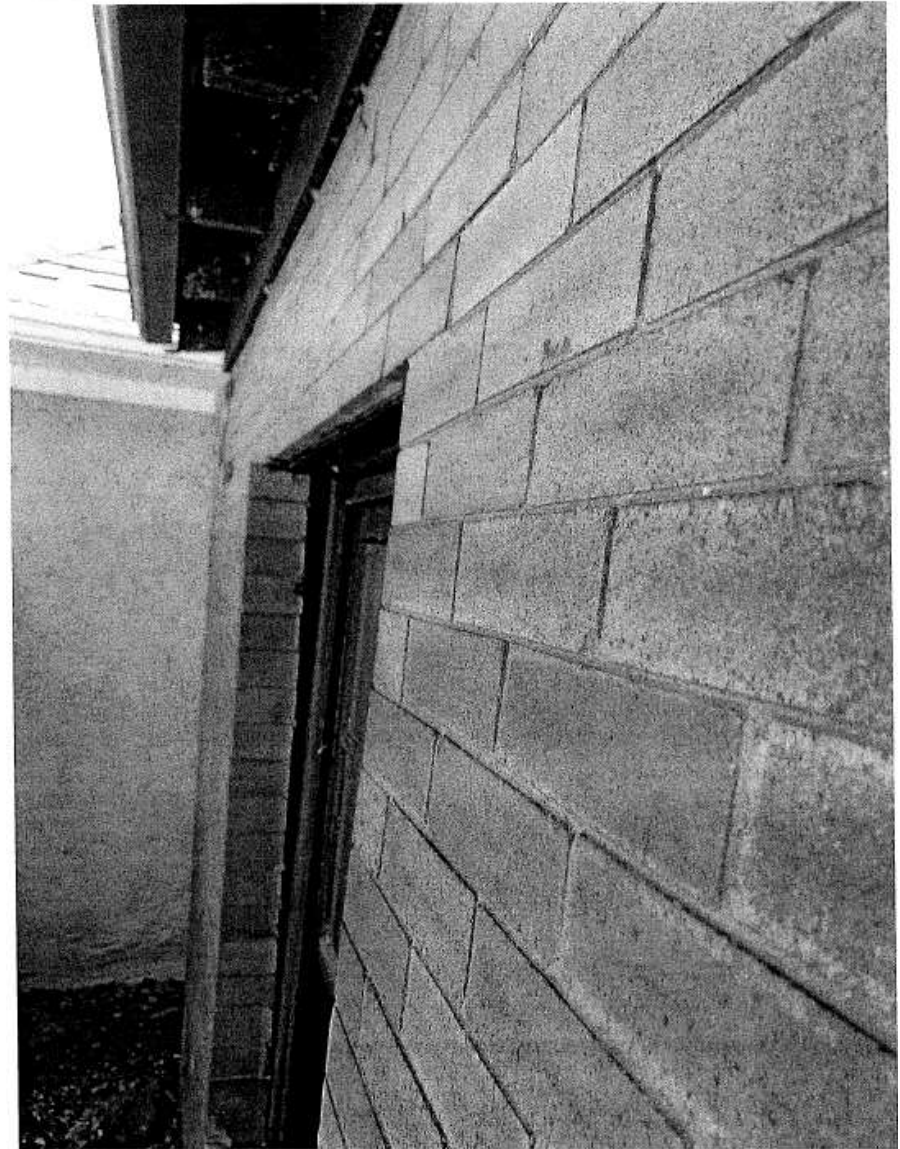

EASTERN PORTION OF NORTH WALL

Typical Conditions