

CERTIFICATE OF APPROPRIATENESS APPLICATION IMAGES

LION HOUSE

CONCORDIA HISTORIC DISTRICT

3209 WEST HIGHLAND BOULEVARD

MILWAUKEE, WI

2014 Masonry Stabilization and Restoration



Image A: North façade of the Lion House showing the entry stair and flanking lions.



Image B: East façade select bricks at the basement level will be replaced with historic matching units.



Image C: South façade, select bricks at the basement level will be replaced with historic matching units.



Image D: West façade, select bricks at the basement level only will be replaced with historic matching units.



Image E: East pier – The area outlined in red will be spot repointed using a mortar matching the original. Due to severely decomposed bedding mortar, brick may require removal and resetting in new bedding mortar.



Image F: East pier – The brick solid railing wall/pier will be spot repointed using a mortar matching the original. Due to severely decomposed bedding mortar, brick may require removal and resetting in new bedding mortar. Spalling brick will be replaced with salvaged matching units. Stone units at each stair and base of pier will be reset as needed.

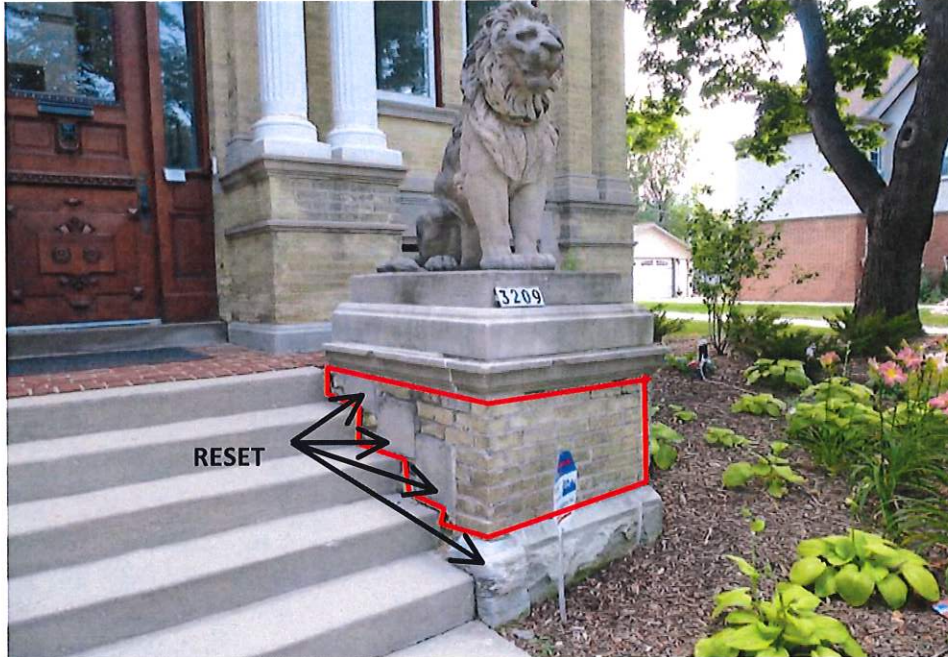


Image G: West pier – The area outlined in red will be spot repointed using a mortar matching the original. Due to severely decomposed bedding mortar, brick may require removal and resetting in new bedding mortar. Spalling brick will be replaced with matching salvaged units. Stone units at each stair and base of pier will be reset as needed.



Image H: West pier – The area outlined in red will be spot repointed using a mortar matching the original. Due to severely decomposed bedding mortar, brick may require removal and resetting in new bedding mortar. Spalling brick will be replaced with salvaged matching units.

END